

DCC/SB

Versailles, le 26/11/2008.

**INFO-TECH CITROËN Sport C2R2 et C2 R2 MAX N° 12/08.**


**Subject :** Racing engine loom, SRA connectors seals.

Dear Customers,

Both engine loom SRA connector seals are primordial for the watertightness of the loom / ECU connection, often exposed to water and humidity (watersplash, humid conditions, high pressure washing and so on).


To get the right reliability of both connections, we recommend to pay attention about the conditions of each seals. After some disassemblies of the ECU (to limit as possible), the seals could be damaged, or cut (as shown on pictures below).

**Small connector (A)**

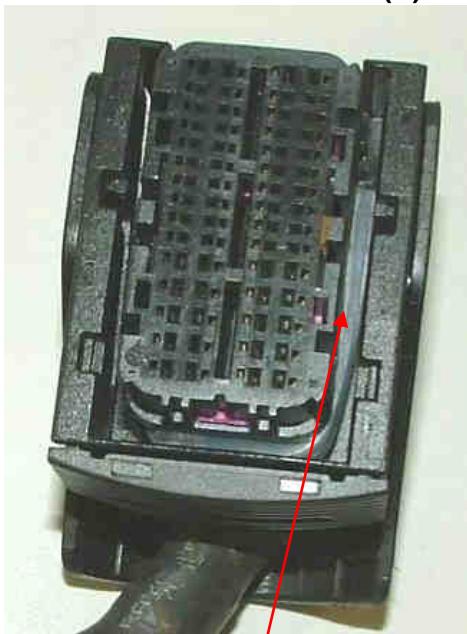

**Seal cut**

**Big connector (B)**

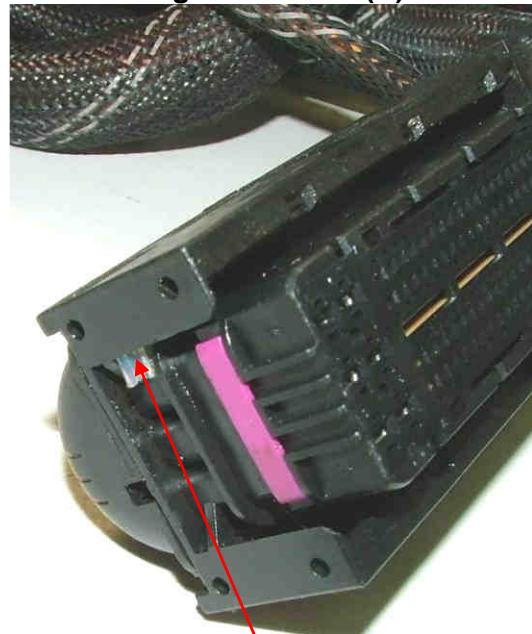

**Seal cut**

You can order brand new seals to the CITROËN Sport shop, under following details :

Description	Part Number	Quantity
Petit joint connecteur SRA	3Z9J86781A	1
Grand joint connecteur SRA	3Z9J86780A	1

***Assembly :***

- Grease the seals before the assembly on connectors, with a « neutral » silicon grease, as *LOCTITE « Grease silicon »*.

**Never use WD40 (or equivalent) or brake cleaner (exaggeration and weakening of the seal)**

- Assembly the right seal on the right connector, and pay attention about the position (seal angles in accordance to connector angles).

Thank you for your attention.

S. BARRAUD, le 26/11/08